Power Port Kit
BM24915

JOHN DEERE

INSTALLATION INSTRUCTIONS

Power Port Kit

M170709 19OCT13 (ENGLISH)

X300, X304, X310, X320, X324 and X360 Tractors

John Deere Horicon Works
M170709 (19OCT13)
PRINTED IN U.S.A.
COPYRIGHT © 2013
DEERE & COMPANY
Moline, Illinois
All rights reserved.
A John Deere ILLUSTRUCTION ® Manual

M170709-19-19OCT13

BM24915

Parts In Kit

NOTE: This kit is compatible for X300 models with starting serial numbers 250001-.

Quantity	Description
1	Power Port, 12V (with cover)
1	Harness, Power Port
1	Fuse, 10 Amp

NOTE: Retain these installation instructions with your machine operator's manual.

OUMX068,0000396 -19-19OCT13-1/1

Parking Safely

1. Stop machine on a level surface, not on a slope.
2. Disengage mower blades or any other attachments.
3. Lower attachments to the ground.
4. Lock the park brake.
5. Stop the engine.
6. Remove the key.
7. Wait for engine and all moving parts to stop before you leave the operator seat.
8. Close fuel shutoff valve, if your machine is equipped.
9. Disconnect the negative battery cable or remove the spark plug wires (for gasoline engines) before servicing the machine.

OUO2005,00000F1 -19-17APR13-1/1

Install Power Port Kit

1. Tilt hood forward.
2. Remove plug (A) from lower console.

A—Plug

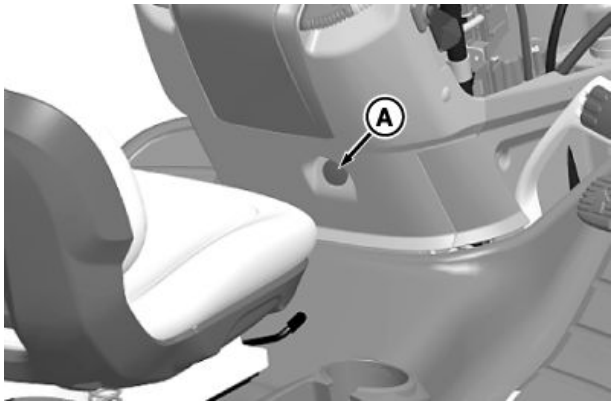

MXT009446 —UN—19OCT13

OUMX068,0000397 -19-19OCT13-1/4

3. Align two locking tabs on power port (A) with mounting hole in console. Push power port into console until locking tabs snap in place to secure.

A—Power Port

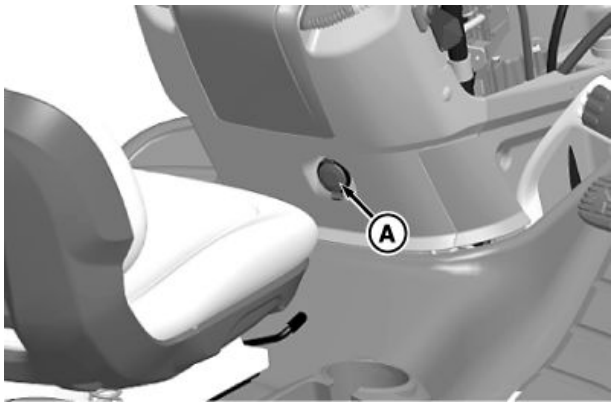

MXT009447 —UN—19OCT13

Continued on next page

OUMX068,0000397 -19-19OCT13-2/4

4. Connect plug (A) on power port harness to power port (B) on engine side of console.
5. Route harness to load center (C) on right side console support behind battery.
6. Connect push-on terminal, short wire (D), from harness to cavity C5 in load center.

A—Plug
B—Power Port
C—Load Center
D—Short Wire

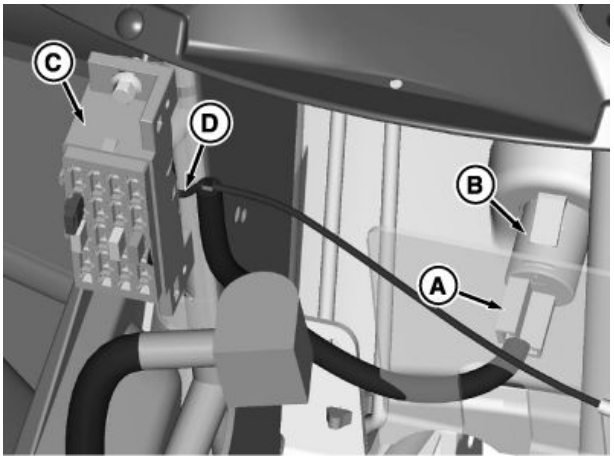

MXT009448 —UN—19OCT13

Battery removed and battery support bracket partially hidden for clarity.

OUMX068,0000397 -19-19OCT13-3/4

7. Route long wire (A) from harness (with ring terminal) to negative battery terminal, and assemble on terminal bolt.
8. Connect negative battery cable over ring terminal and tighten nut.
9. Install fuse (B) in position C5—6 in load center.

A—Long Wire
B—Fuse, 10A

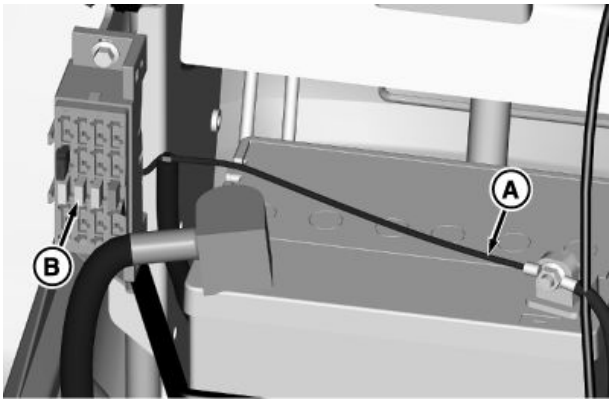

MXT009449 —UN—19OCT13

OUMX068,0000397 -19-19OCT13-4/4