

Windshield Kit

BM23373



JOHN DEERE

INSTALLATION INSTRUCTIONS

Windshield Kit

M162161 09APR20 (ENGLISH)

RSX850i, RSX860E, RSX860i, RSX860M, XUV550,
XUV550 S4, XUV560, XUV560 S4, XUV560E, XUV560E S4,
XUV590E, XUV590E S4, XUV590i, XUV590i S4, XUV590M,
XUV590M S4 Gator™ Utility Vehicles


John Deere Horicon Works
M162161 (09APR20)

PRINTED IN U.S.A.
COPYRIGHT © 2020
DEERE & COMPANY
Moline, Illinois

All rights reserved.
A John Deere ILLUSTRATION™ Manual

M162161-19-09APR20

Parts in Kit

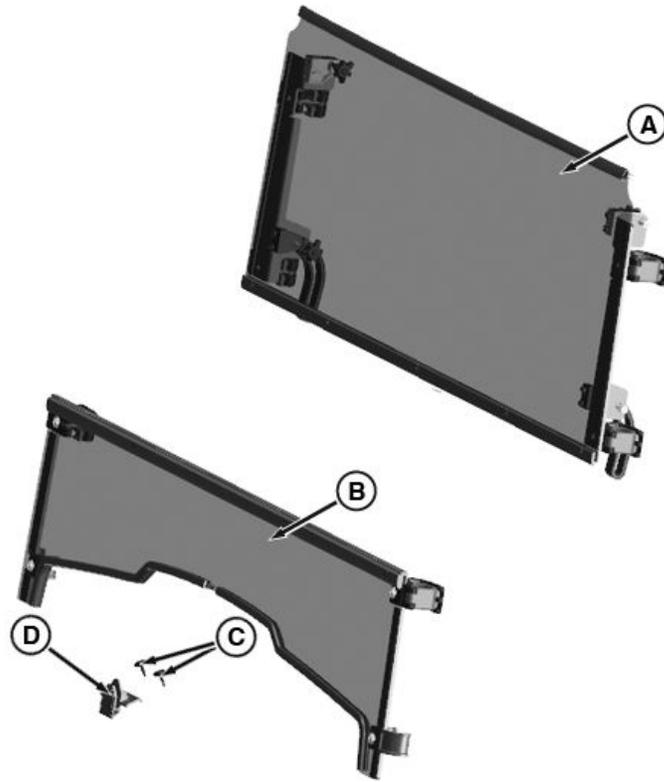

Quantity	Description
1	Upper Windshield Assembly (A)
1	Lower Windshield Assembly (B)
2	Self-Tapping Screw (C)
1	Windshield Center Support (D)

NOTE: Retain these installation instructions with the machine operator's manual.

BVVMSIT,000024B -19-01APR20-1/1

APY30681 —UN—01APR20

Parking Safely


Park the machine safely. See Parking Safely in your Operator's Manual.

MX88017,0000007 -19-17OCT19-1/1

Install Kit

1. Park machine safely. (See 'Parking Safely'.)
2. Install windshield center support (A) on the dash panel (B) with self-tapping screws (C).

A—Windshield Center Support **C—Self-Tapping Screw (2 used)**
B—Dash Panel

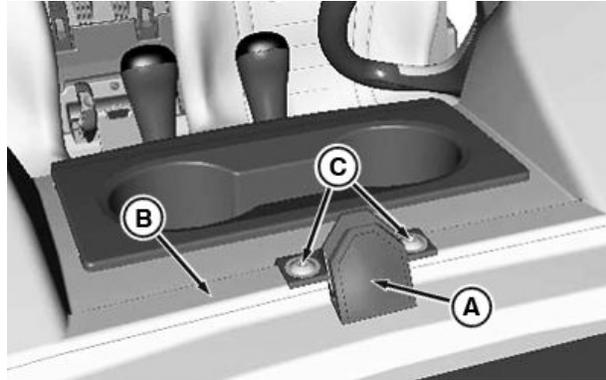


APY30677 —UN—30MAR20

BVMSIT,000024C -19-08APR20-1/3

3. With the cam locking clamps (A) open, position the lower windshield assembly (B) over the occupant protective structure (OPS) tubes just above the windshield support.
4. Snap clamps (C) onto OPS tubes, and slide the lower windshield assembly (B) down until fully seated in windshield center support.
5. Align cam locking clamps (A) with OPS, and snap shut.

A—Cam Locking Clamp (2 used) **C—Clamp (2 used)**
B—Lower Windshield Assembly

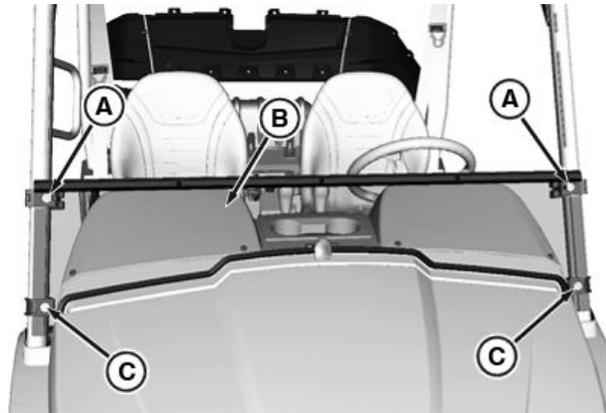


APY30678 —UN—30MAR20

BVMSIT,000024C -19-08APR20-2/3

6. With the cam locking clamps (A) open, position the upper windshield assembly (B) over the OPS tubes.
7. While attaining a proper seal and fit at the bottom of the windshield (C), align the cam locking clamps (A) with the OPS, and snap shut.

A—Cam Locking Clamp (4 used) **C—Windshield Bottom**
B—Upper Windshield Assembly

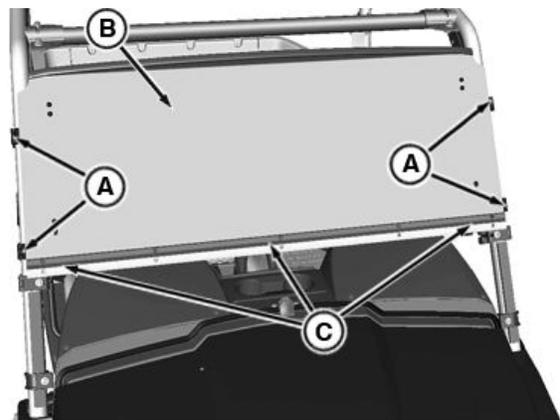

APY30679 —UN—30MAR20

BVMSIT,000024C -19-08APR20-3/3

Checking Windshield Regularly

The windshield and windscreen are a polycarbonate material which is softer but stronger than glass.

Before washing, flush as much loose dirt off as possible by thoroughly rinsing with warm water using a soft cloth or sponge. Wash with mild soap or detergent and rinse thoroughly with clean water.

The following cleaning agents are compatible with polycarbonate when used according to the manufacturer recommendations:

- Formula 409® (without ammonia)
- Joy®
- Palmolive® Liquid

To prevent water spots, thoroughly dry the windshield with a chamois or moist sponge. Do not use abrasive cleaners. Avoid cleaning in direct sunlight for preventing the streaks.

IMPORTANT: Avoid damage! Some cleaning compounds can attack the polycarbonate material, resulting in cracks that weaken the material.

Never use compounds that contain substances such as ammonia, gasoline, lacquer thinner, and turpentine.

Formula 409 is a trademark of The Clorox Company

Joy is a trademark of Procter & Gamble

Palmolive is a trademark of Colgate-Palmolive

PlastX is a trademark of Meguiar's Inc.

SC Johnson is a trademark of SC Johnson & Son, Inc.

Never use substances such as acetic acid, acetone, benzene, benzyl alcohol, brake fluid, butyric acid, carbon tetrachloride, ethyl ether, methyl alcohol, phenol, sodium sulfide, sodium hydroxide, sodium nitrate, trichloroethylene, toluene, xylene, or petroleum products.

To minimize scratches and improve visibility by filling in existing scratches, it is recommended that the windows are polished, or waxed regularly.

Some commercially available polishes, and waxes that are recommended include:

- PlastX™ Clear Plastic Cleaner & Polish
- SC Johnson® Paste Wax

First, test the effectiveness of the polish, or wax at the small corner of the windshield.

IMPORTANT: Avoid damage! If cracks or surface crazing is observed, or viewing through the windshield is impaired, replace the windshield.

BVVMSIT,000024D -19-30MAR20-1/1

Service Clamps

Check and adjust the tightness of the clamps after the first 30 days of use.

BVVMSIT,000024E -19-30MAR20-1/1

